

**OPERATION MANUAL**  
**for the**  
**GOODWIN P18**  
**AIR PLASMA CUTTING SYSTEM**

The Company reserves the right to make such changes to the design or specification of the equipment as it shall see fit. The information contained in this manual is issued for the guidance of users and does not form part of any contract. It is strongly recommended that all users and supervisors familiarise themselves with the contents...

#### PRIOR TO COMMENCING USE OF THE SYSTEM

...and in particular, the section on safety precautions which should be used as a guide to safe operation in accordance with the requirements of the relevant Health and Safety at Work legislation.

### **GOODWIN AIR PLASMA LIMITED**

KERNAN DRIVE  
LOUGHBOROUGH  
LEICESTERSHIRE  
LE11 5JF  
ENGLAND

**Tel No. ++(0) 01509 237369**

**Fax No. ++(0) 01509 234942**

**Email. [goodplasma@compuserve.com](mailto:goodplasma@compuserve.com)**

# Contents

<b>1.</b>	<b>SAFETY</b>	<b>4</b>
1.1	General	4
1.2	Safety Features	5
1.3	Warning Signs	5
1.4	Packaging Handling and Transport	5
<b>2.</b>	<b>INTRODUCTION TO THE PLASMA PROCESS</b>	<b>6</b>
<b>3.</b>	<b>INSTALLATION</b>	<b>7</b>
3.1	Power Supply	7
3.2	Earth Requirements	7
3.3	Phase Determination	7
<b>4.</b>	<b>PLASMA AND TORCH CONNECTIONS</b>	<b>8</b>
4.1	Connecting the Torch and Plasma Earth Lead to the Power Unit	8
4.2	Control of Hand Torch	9
4.3	Control of Machine Torch	9
<b>5.</b>	<b>OPERATION</b>	<b>10</b>
5.1	Machine Controls	10
5.2	Power Up Procedure	11
5.3	Cutting Procedure	12
5.3.1.	Starting and Finishing a Cut.	12
5.3.2.	Cutting With Stand Off.	12
5.3.3.	Cutting Speed.	13
5.3.4.	Piercing Thicker Materials with a Hand Torch	14
5.3.5.	Piercing with a Machine Torch	15
5.4	Troubleshooting	16
5.5.	Consumable Life.	16
5.5.1.	Intrinsic Life.	16
5.5.2.	Alignment.	16
5.5.3.	Transient Damage.	16
5.5.4.	Operational Damage.	17
5.5.5.	Electrode “non-starting”.	17
5.6	Changing Consumables	18
<b>6.</b>	<b>TECHNICAL DATA</b>	<b>20</b>
6.1	Power Unit	20
6.1.1.	Electrical Input	20
<b>6.1.2.</b>	<b>Electrical Output</b>	<b>20</b>
6.2	Torch and Hose Set	20
6.2.1	Hand Torch	20
6.2.2	Machine Torch	20
<b>7.</b>	<b>SERVICE INFORMATION</b>	<b>21</b>
7.1	The Power Unit	21
7.1.1.	Circuit Diagram	22
7.1.2.	Diagnostic Indicators.	23
7.1.2.	Machine Layout	24
7.2	The Torch and Hose Set Repair	25
7.3	Maintenance	26
<b>8.</b>	<b>Torch Blockage</b>	<b>27</b>
8.1	Machine Torch	27
8.2	Hand Torch	28
8.3	Hand Torch exploded View	29
8.4	Machine Torch exploded View	30
<b>9.</b>	<b>Fault Finding</b>	<b>31</b>
<b>10.</b>	<b>Index</b>	<b>32</b>

# 1. SAFETY

## 1.1 General

Before any cutting operations are started, the user must ensure that the installation and proposed working methods comply with all relevant safety regulations, environmental and electricity standards.

The plasma arc produced at the torch head is a jet of high energy and is potentially dangerous. Users unfamiliar with a plasma arc should seek basic training. Goodwin Air Plasma can offer comprehensive training courses.

In addition, the following points are particularly important:

- a) The mains connection must be properly grounded and the supply lines fitted with fuses of the specified rating. The mains cable must be properly secured and protected from possible damage.
- b) High voltage exists at the torch when power is applied and the pilot arc is struck (up to 300V), and when the main arc is cutting (150V). Under no circumstances should anyone touch the nozzle with power applied to the torch. All adjustments and replacement of parts should be done with the power unit supply isolated. The torch should not be used in excessively wet conditions or if the torch or hose set are damaged in any way.
- c) The mains supply should be isolated from the unit AT THE SUPPLY before removing any panels from the unit. Only authorised service personnel should remove panels.
- d) Keep the work area clear of all inflammable materials. Ensure that any material ejected from the cut is not a hazard to the operator or to others.
- e) Protection is necessary against ultraviolet radiation emitted from the arc. A helmet or shield with shade glass is recommended. Wear gloves and adequate protective clothing where appropriate. Adequate screening should be arranged to protect others in the vicinity or passing by in a similar manner to that required for arc welding operations.
- f) Adequate ventilation or fume extraction to remove the cutting fume and dust is required at all times around any plasma cutting operation. When cutting flat sheet, a shallow water bed cutting table will greatly reduce the fumes and dust which mainly occur below the cut.
- g) The wheels on the unit are meant for ease of movement around the work place and should not be used over rough surfaces nor at excessive speeds.
- h) The plasma power unit should be positioned on stable level ground and if necessary secured against any unwanted movement.
- i) The operation of this equipment and the plasma cutting process can result in noise levels that could be harmful, The employer should undertake a noise assessment to monitor compliance with relevant legislation.
- j) Material to be cut should be supported in such a way that any material cut from the work piece will not be a hazard and fall onto the user, the equipment, or others in the vicinity.
- k) Care should be taken when manoeuvring the hose set with either a hand held torch or one connected to a robot arm or profiler, that it does not snag on objects or other equipment which may result in damage to the hose set, or topple the objects or equipment. Hose sets that are subject to excessive mechanical tension may result in damage to the hose set connections at the machine or the hose set components themselves.

## 1.2 Safety Features

The plasma unit includes the following features for the safety of the operator:

- \* The body of the plasma torch is earthed.
- \* The continuity of the torch earth and the voltage on the body is monitored.
- \* Cutting current flowing in the supply earth is monitored.
- \* The voltage on the torch nozzle is monitored.
- \* In the event of a faulty condition of the above, the machine will switch off power to the torch.


The emergency stop procedure is to turn the main isolator to the off position, which is located on the lower front control panel.

A tool (flat bladed screw driver) is required to remove the canopy for access to the internal components. Under no circumstances should the canopy be removed whilst the mains supply is still connected. Only suitably trained and authorised personnel should remove the canopy.

## 1.3 Warning Signs

The location of the warning signs fitted to the plasma unit are:

- a) At the front of the machine -  
Warning Open Circuit Voltage 300 volts.

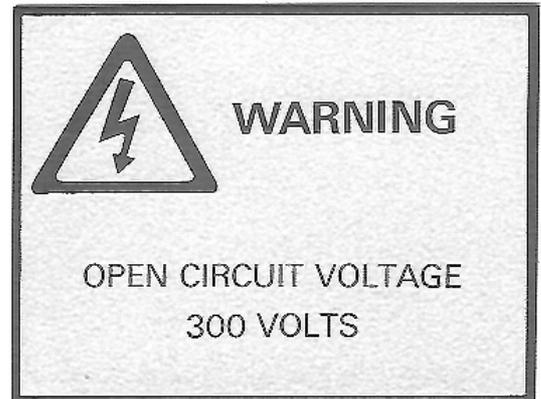

- b) At each rear lower corner of the canopy -  
Warning Disconnect the Mains Supply.....



These should be maintained in a legible condition.

## 1.4 Packaging Handling and Transport

Should the plasma unit need to be shipped, we recommend re-use of the original packing crate. Also:-

- a) That the hose set be disconnected to prevent any damage to the hose set / plasma connections.
- b) That the control panel is adequately protected against potential damage.
- c) Any lifting should be done using the eyebolt located in the top of the canopy together with certified lifting equipment (not supplied). Precautions should be taken to prevent rotation about the eyebolt.
- d) The plasma unit should be shipped and stored in the upright position to avoid any heavy internal components breaking free from their mountings.
- e) Storage should be undercover, preferably in a clean dry environment.

## **2. INTRODUCTION TO THE PLASMA PROCESS**

The plasma process is created by passing a stream of clean ionised air, provided by an oil free compressor, through a NOZZLE in the torch. The air stream is ionised by a PILOT ARC, initiated by a HIGH FREQUENCY unit (HF Unit) which passes from the ELECTRODE to the nozzle when the torch is activated. When the PILOT ARC is brought close to the work piece, MAIN ARC is TRANSFERRED to the work piece as a jet of high energy which rapidly melts any metal with which it makes contact, providing fast cutting, low residual heat input, and low material distortion.

The electrode and nozzle are cooled by air (and water in water cooled torches), and as the air is passed through the nozzle it is caused to swirl around the arc by a SWIRL BUSH to aid stability of the arc.

The HF unit operates automatically to establish an arc when power is applied to the torch and it ceases to operate when the pilot or main arc is established.

### 3. INSTALLATION

May be carried out by a competent electrician. No specialist tools are required.

#### 3.1 Power Supply


The power unit is provided with a length of flexible cable which must be connected to the customer's 3 phase and earth electrical supply. The supply should be fitted with fuses or circuit breakers of appropriate rating and a means of isolating the power unit from the supply. A plug should be fitted if appropriate. The machine is phase/rotation sensitive.

Refer to the rating plate on the machine and Technical Data section 6.1.1. for the correct voltage and current requirements.

#### 3.2 Earth Requirements

The installation should be arranged such that the only path to earth (or ground) from the work piece is by way of the plasma earth lead connected to the front of the machine.

Where the material to be cut forms part of the structure which is earthed or grounded to the mains electrical supply system, then the cutting current could flow through that route rather than the plasma earth lead to the machine. Always ensure that there is a good connection between the work piece and the machine via the plasma earth lead as a poor connection will cause excessive current in the mains supply earth which will create a current trip fault condition.

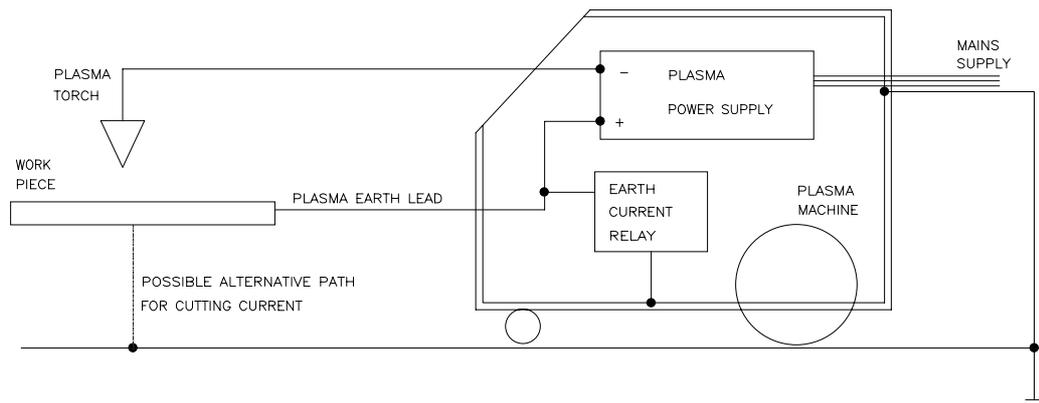

In installations where it is not possible to avoid earth current trips, even though a good cutting current earth path has been ensured, it will be necessary to check that the alternative mains earth paths are substantial enough to carry higher currents than the current trip setting of 10 amps without causing damage, as where the cutting earth is not connected to the work piece at all, this would be the full cutting current. If the earth paths are not substantial they must be upgraded or rerouted to avoid the possibility of damage. Once the necessary checks and precautions have been taken, the earth current trip circuit may be disabled by means of the switch on the Earth Current Relay (ECR) located inside the power unit.

#### 3.3 Phase Determination

Connect the torch to the machine (see section 4).

Switch on the machine by rotating the main isolator.

Correct phase connection is determined by checking that the cooling air flowing through the power unit is from the front panel to the rear of machine. If this is incorrect, change two of the three phase connections at the power supply and check again.

If there is any doubt regarding installation, consult your distributor or Goodwin Air Plasma.

## 4. PLASMA AND TORCH CONNECTIONS

### 4.1 Connecting the Torch and Plasma Earth Lead to the Power Unit

**Note.** Do not run the power unit without the torch connected.

Torch connection to the power unit is made by a "push in" connector plug to a socket on the front of the power unit designed to prevent accidental removal of the hose set. A pointed tool is supplied in the tool kit for the purpose of allowing the hose set to be connected and disconnected.

To connect the hose set, insert the connector plug into the socket and press the pointed tool into the small hole (see illustration), whilst rotating the knurled securing collar.




Note that a sealing ring is located in the base of the torch connector socket to form an air seal with the centre power pin. Care should be taken to ensure that this seal is not displaced and that the end of the pin is not damaged when the torch plug is removed.

The plasma earth lead is connected via the push in and twist clockwise socket.

POINTED TOOL



### DIAGRAM TO SHOW POSITION OF EARTH AND TORCH CONNECTIONS.

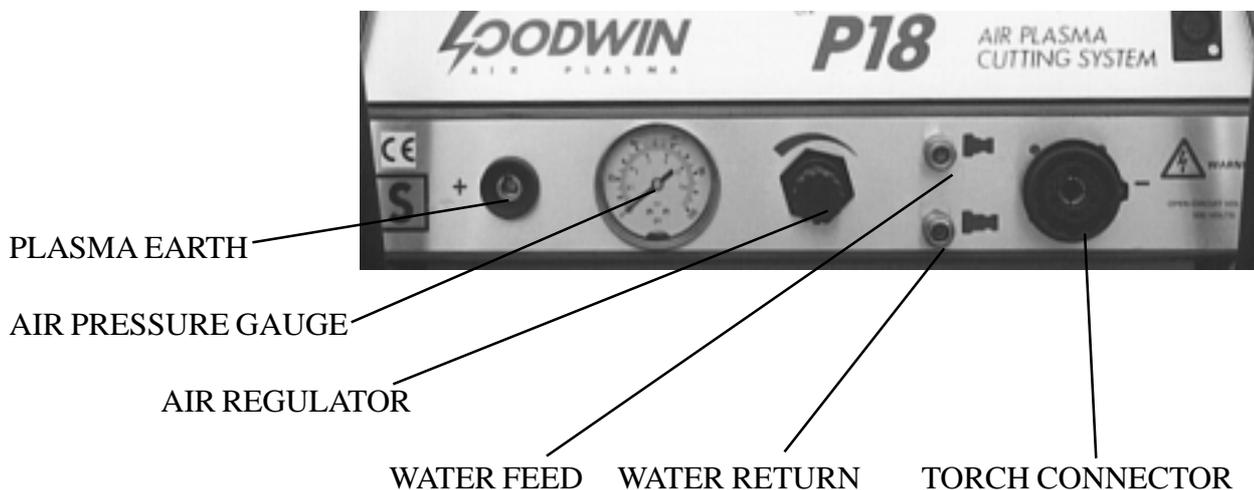

## 4.2 Control of Hand Torch

The hand torch is provided with a press on / release off control switch on the handle for operation of the plasma arc.

**Note.** Air will flow through the torch at all times when the machine is switched on.


If a hand torch is to be used in conjunction with a mechanical manipulator or tractor unit etc., when the operation of the handle mounted press on / release off control switch will not be possible, plug the remote control switch unit into the remote control socket as for the machine torch.

## 4.3 Control of Machine Torch

If the machine torch is used, plug the remote control plug into the remote control socket.

If the machine is to be interfaced to a profiling machine, robot or other automatic system, the following remote control socket connections may be used.

### REMOTE CONTROL SOCKET

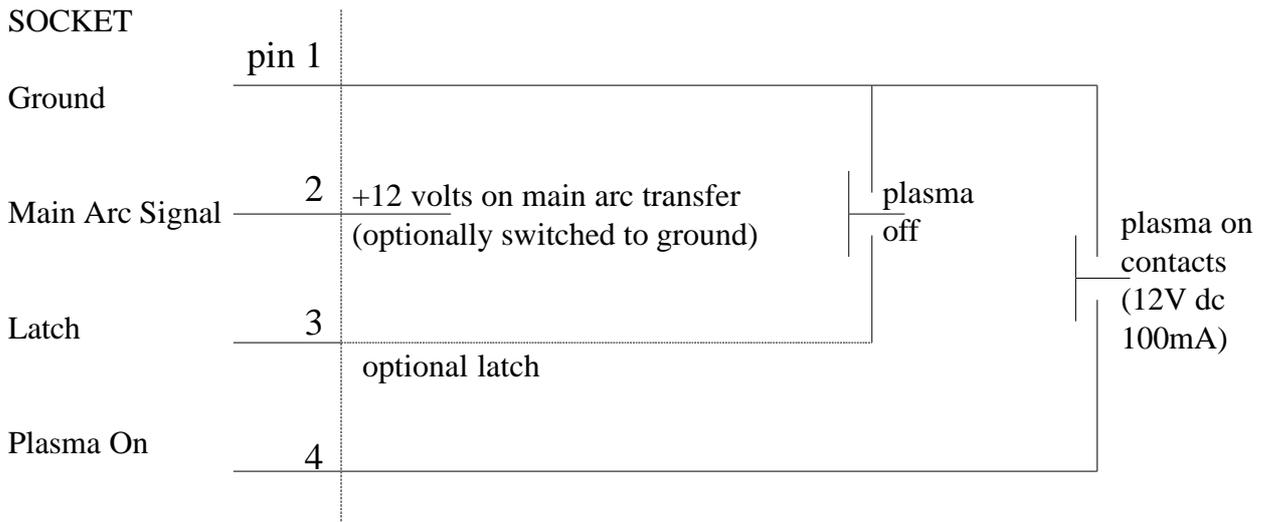


Pilot arc relay contacts can also be provided when necessary. If in doubt contact Goodwin Air Plasma for advice on interfacing to other equipment.

## 5 OPERATION

### 5.1 Machine Controls

The front panel of the machine provides a range of displays and control gear to ensure correct operation.

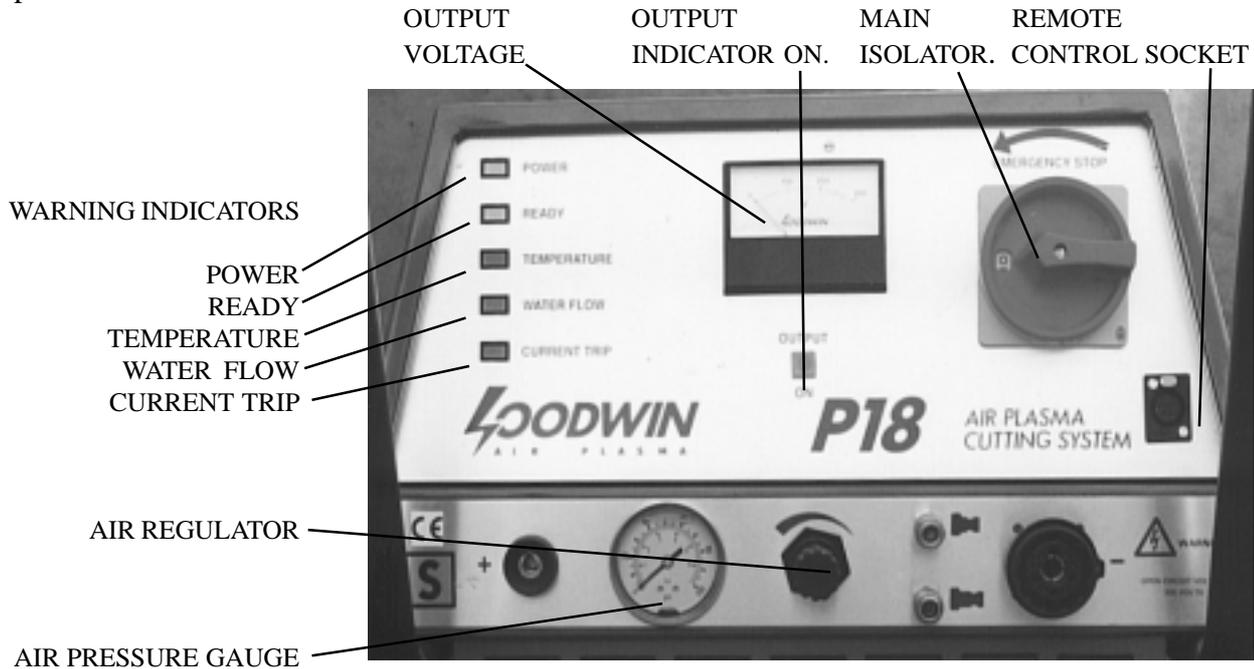

#### MAIN ISOLATOR.

Switches machine on and off.

#### OUTPUT "ON" NEON.

Indicates that power is applied to the torch.

#### OUTPUT VOLTAGE METER

Indicates output voltage. Typical values are:

Power applied but no arc	300v
Pilot arc	250/280v
Main arc	120/150/180v

#### POWER INDICATOR.

Indicates that power is available to the system control circuit.

#### READY INDICATOR.

Indicates that all system interlocks are operational and that the machine is ready to operate.

#### TEMPERATURE INDICATOR.

Indicates when the main transformer temperature is too high. Cutting operations will immediately stop. Do not switch off supply, allow the fan to cool the machine

**Note. This safety feature is not designed nor intended to be a means to control the duty cycle. It is the user's responsibility to ensure the machine is operated within its duty capability such that the machine does not exceed its temperature limitations during cutting operations.**

#### WATER FLOW INDICATOR.

Indicates the the loss of water pressure from the torch.

#### CURRENT TRIP INDICATOR.

Indicates excessive pilot arc current due to incorrectly installed or damaged consumables in the torch, or insufficient air flowing through torch, or the main arc cutting current is flowing in a secondary earth path.

#### AIR PRESSURE GAUGE.

Displays the back pressure in the system for setting the pilot arc air pressure, during pilot arc and during cutting modes. Typical values would be:

For setting Pilot Arc	10 to 15 psi.(0.65 to 1.0 bar)
During Pilot Arc	10 to 20 psi (0.65 to 1.4 bar)
During Main Arc	35 to 45 psi (2.5 to 3.2 bar)

#### AIR REGULATOR.

Sets the air flow through the torch. Adjust for a stable pilot arc.

#### REMOTE CONTROL SOCKET.

For the connection of a machine torch remote control unit.

#### NOTE.

As plasma power units do not have a voltage stabilised power supply, a fluctuation in the input voltage will directly affect the output current. This may not be noticeable if the input voltage rises slightly above the norm as it will provide more power for cutting. If the rise is excessive, consumable life may suffer. However, when the input voltage falls, the output power also falls, affecting both the pilot arc and main arc. In these circumstances it will be necessary to adjust the air pressure regulator to reduce the airflow to obtain a stable pilot arc, and readjust it when the mains voltage returns to normal.

## 5.2 Power Up Procedure

Having completed the mains and cutting earth wiring, connected the torch and checked the fan rotation, the machine is ready for use.

To ascertain the absence of air leaks, the air regulator should be wound fully anti-clockwise and the pressure gauge should indicate a back pressure of 1.7 bar.

It is now necessary to adjust the air pressure to give the highest possible reading consistent with good arc starting and a stable pilot arc. Switch on the torch with the nozzle well clear of any work piece, person or equipment, and adjust the air pressure until it is at maximum or the pilot arc becomes unstable (very noisy, misfire, and the output showing 300 volts). At this point reduce the pressure to restore stability (arc less noisy, stable arc, and the voltage indicator showing 250/280 volts).

Always maintain as high an air pressure as possible for pilot arc as this gives the best consumable life.

The output neon is “on” and the output reads between 250 vdc and 280 vdc at this stage.

## 5.3 Cutting Procedure

### 5.3.1. Starting and Finishing a Cut.


Where possible it is better to start a cut at a plate edge or hole because the piercing process reduces consumable life.

Cuts can be started by either initiating the pilot arc and moving the torch into the proximity of the work piece, or by positioning the torch over the edge of the work piece and starting the pilot arc.

Materials with a capacity to absorb heat energy, especially thicker sections, require more care and technique when starting a cut. In these cases the cut will appear slow to start and pierce through the material. Once a cut is established then cutting speeds may be increased.

Cutting can be stopped either by releasing the torch switch, switching off the power, or by withdrawing from the workpiece (best done rapidly).

### 5.3.2, Cutting With Stand Off.

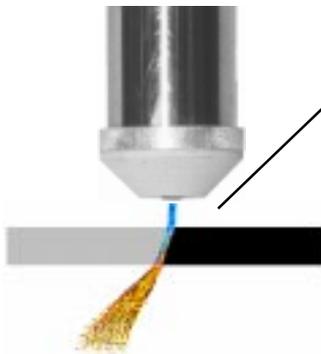

Under normal cutting conditions the torch is designed to operate with a STAND OFF of about 6 mm. This is the distance between the end of the nozzle and the work piece.

Where the work piece is rusty, scaly, or with thick sections of steel or aluminium etc., a build up of dross on the top of the work piece may occur which will cause damage to the nozzle. In these conditions, the stand off distance should be increased slightly.

A guide ring is available to assist the operator in maintaining the desired stand off height. This can also be used against a straight edge to maintain a straight cut.

## IMPORTANT

If the arc should “flare”, be coloured green, or emit any unusual noise, it is recommended that the unit be immediately switched off and the condition of the consumables checked. Cutting under these conditions may result in damage extending beyond the consumables to other parts of the torch.


### 5.3.3. Cutting Speed.

Best results are usually obtained by cutting at the optimum cutting speed.



#### OPTIMUM CUTTING SPEED

Correct cutting speed is judged by experience from observing the angle at which the cut material leaves the lower edge of the plate, either by observing the ejected material or by studying the surface of a cut after completing a test cut. The drag back of the arc is approximately 30 degrees.

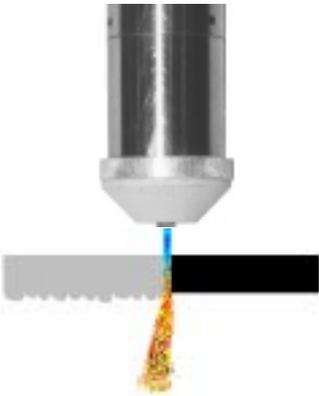

#### CUTTING TOO SLOW

Arc appears to blow straight through the material. Excessive dross may accumulate on the underside of the material.



#### CUTTING TOO FAST

Arc fails to pierce the material. Blow back of dross will damage the nozzle.




#### MAXIMUM CUTTING SPEED

Drag back of the arc is around 45°, but cut quality will deteriorate.


### 5.3.4. Piercing Thicker Materials with a Hand Torch

Piercing will cause cut material to be ejected upwards which can be dangerous, and has a risk of damaging the torch nozzle. This problem is worsened as material thickness increases because it takes longer to pierce. If it is necessary to pierce, then it is best done by angling the torch and gradually bringing it upright as piercing is completed.

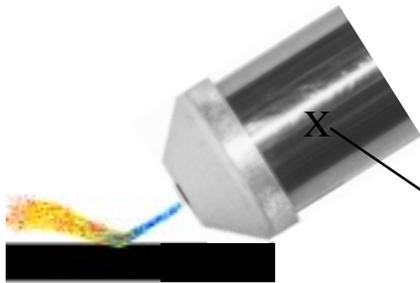


Initiate the pilot arc and lay the torch over at approximately 60°

Imaginary pivot point. X

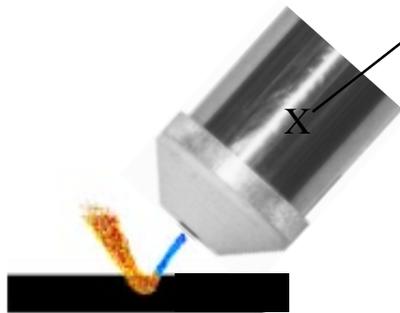

Begin twisting the torch slowly towards a vertical position taking care to avoid ejected material from hitting the nozzle. At the same time, the torch should be moved a small distance along the work piece.

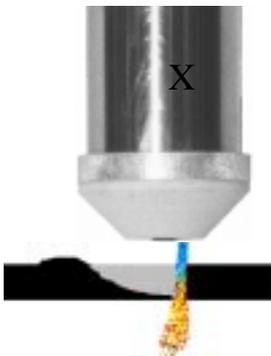

As piercing completes, the nozzle can be brought to vertical and cutting can continue.




If the torch is pivoted about the nozzle there is a risk of material being blown back onto the nozzle which will cause damage to the nozzle or even to the torch itself.

### 5.3.5. Piercing with a Machine Torch

When using a machine torch, it is not generally possible to angle the torch for piercing. Start the pilot arc above the work piece, and with the torch travelling at about half of the normal cutting speed, lower the torch until main arc transfer occurs. Once piercing is complete, the torch may be brought to normal stand off and cutting speed.

Goodwin Air Plasma offer an Automatic Height Control Unit as an optional extra for machine torches integrated with profiling machines or robot arms. Ask your distributor or Goodwin Air Plasma for further details.

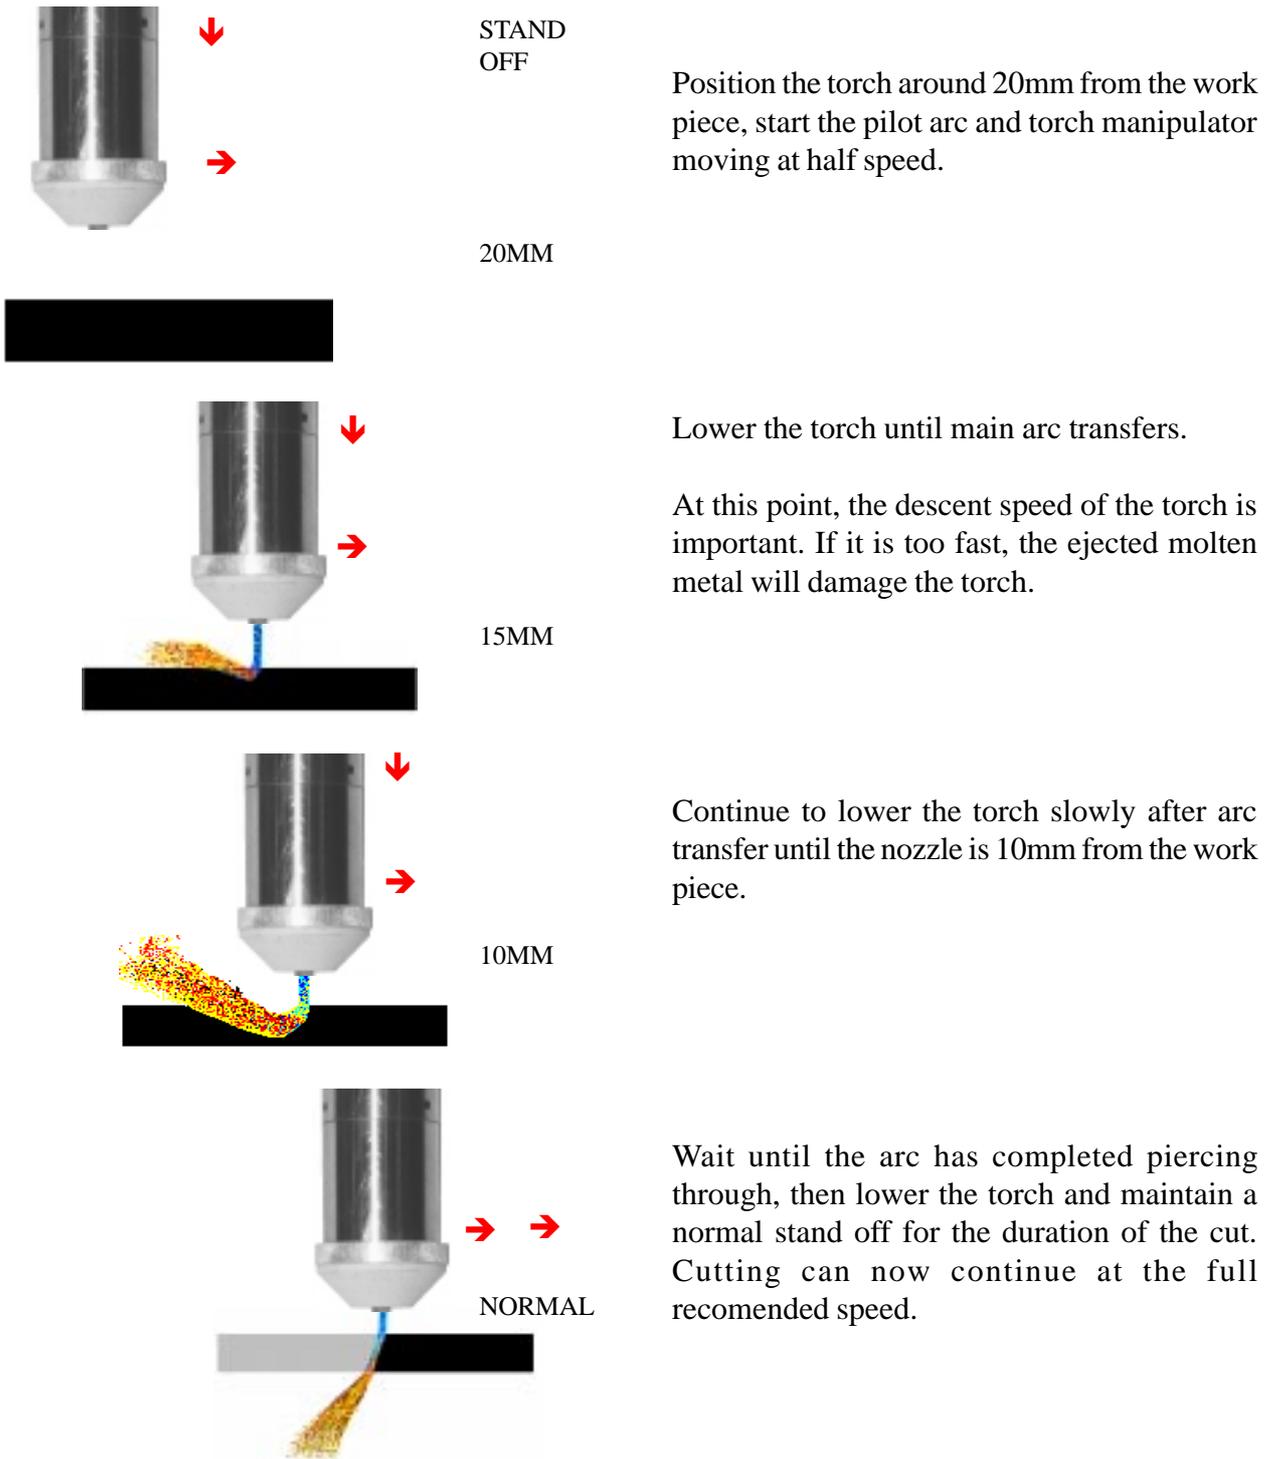

## 5.4 Troubleshooting

Excessive dross on lower edge of cut.	Cutting speed too slow. Torch consumables worn or damaged. Insufficient air flow.
Double arcing.	Damaged torch consumables. Nozzle blocked by dross or too close to work piece. Insufficient air flow.
Main arc not square to work piece.	Nozzle orifice damaged. Electrode eroded "off centre". Consumables wrongly fitted.
Excessive bevel or rounded cut surface.	Speed too high. Stand off too high. Arc not straight - consumables damaged or misaligned.

Bevel is more noticeable on thinner sections and is more pronounced on the left hand side of a cut. It is due to the clockwise swirling of the air induced by the swirl bush in the electrode assembly. Bevel edges can be desirable as an aid to weld preparation, however it can be virtually eliminated by reducing the cutting speed but at the expense of accumulated dross. For minimum bevel cut clockwise around a component and anticlockwise in a hole.

## 5.5. Consumable Life.

A good consumable life is the single most important factor in achieving optimum cutting economics of any plasma cutting unit. This life is dependent on the intrinsic life of the consumables, correct alignment and the incidence of transient and operational damage.

### 5.5.1. Intrinsic Life.

The intrinsic life of the consumables is determined by the rate at which they are eroded by the arc process. This erosion rate is however low, and in practice, the life is limited by other factors. The insert in the centre will be eroded slightly each time the arc is struck eventually creating a visible crater. The crater can be more than 2mm deep before the electrode is considered to be expired.

### 5.5.2. Alignment.

The alignment and construction of the Goodwin Air Plasma Torch is such that problems of grinding and adjusting electrodes do not occur. With reasonable care taken in fitting the consumables, alignment problems should not arise.

### 5.5.3. Transient Damage.

On starting directly onto main arc, it is occasionally possible to erode some of the copper from the electrode before the arc settles onto the insert material. This generates a crater in the electrode and the insert burns back to become flush. Consumable life is thus reduced if there is a high number of starts relative to the total cutting time.

#### 5.5.4. Operational Damage.

This is the most likely cause of limited consumable life. Since the arc is quite capable of cutting copper, anything which causes the arc to deviate from the centre of the nozzle will result in damage to the orifice. In extreme cases the arc passes not through the orifice but from the electrode to the nozzle and from the nozzle to the work piece - DOUBLE ARCING, causing the rapid erosion of copper from both electrode and nozzle.

The most common cause of these problems is from ejected cut material entering the orifice particularly when piercing or obstructing the nozzle with the work piece.

It is best to operate within the maximum speed capabilities of the machine and avoid unnecessary piercing or stop-start cutting whenever possible.


#### 5.5.5. Electrode “non-starting”.

Occasionally, it may happen that it is difficult to start the pilot arc. This happens when the oxidized material from the electrode insert is deposited over the surface of the copper electrode and inside the nozzle. Starting can be improved by cleaning or scratching the surface of the electrode with a wire brush or sharp implement. Always switch off the power unit before removing the nozzle for this purpose. Once a “non-starting” electrode has been used a few times, starting usually improves.

It is not good practice to fire the pilot arc continually in midair without striking the cutting arc as this oxidizes the surface of the electrode and leads to “non-starting” problems.

Since cutting usually improves a non-starting electrode, it may be desirable to use a piece of scrap material and start the main arc immediately by positioning the torch close to the material before switching on. Once started, continue to cut for as long as possible before trying to re-initiate the pilot arc.

#### ILLUSTRATION TO SHOW ELECTRODE DAMAGE

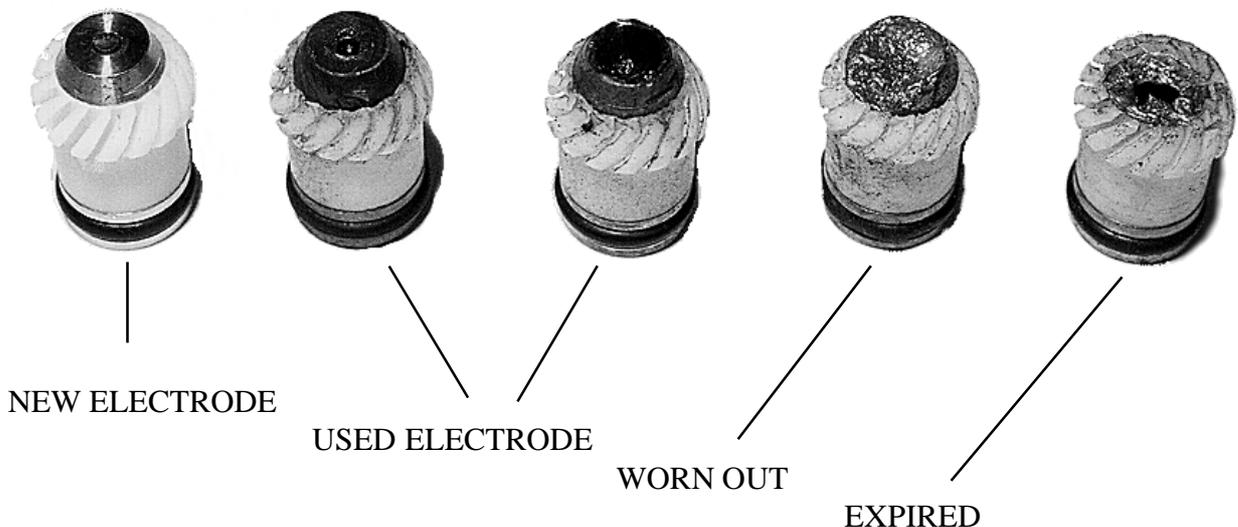


## 5.6 Changing Consumables

The Goodwin Water Cooled torch carries a number of elements known as the CONSUMABLES which are eroded during the cutting process. They consist of:

- a) Nozzle.
- b) Electrode Assembly comprising:
  - Electrode
  - Swirl Bush
  - O ring

Other parts that may be damaged and replaced by the user are:

Front Cap  
Front Cap Retaining Ring  
Contact Tube.

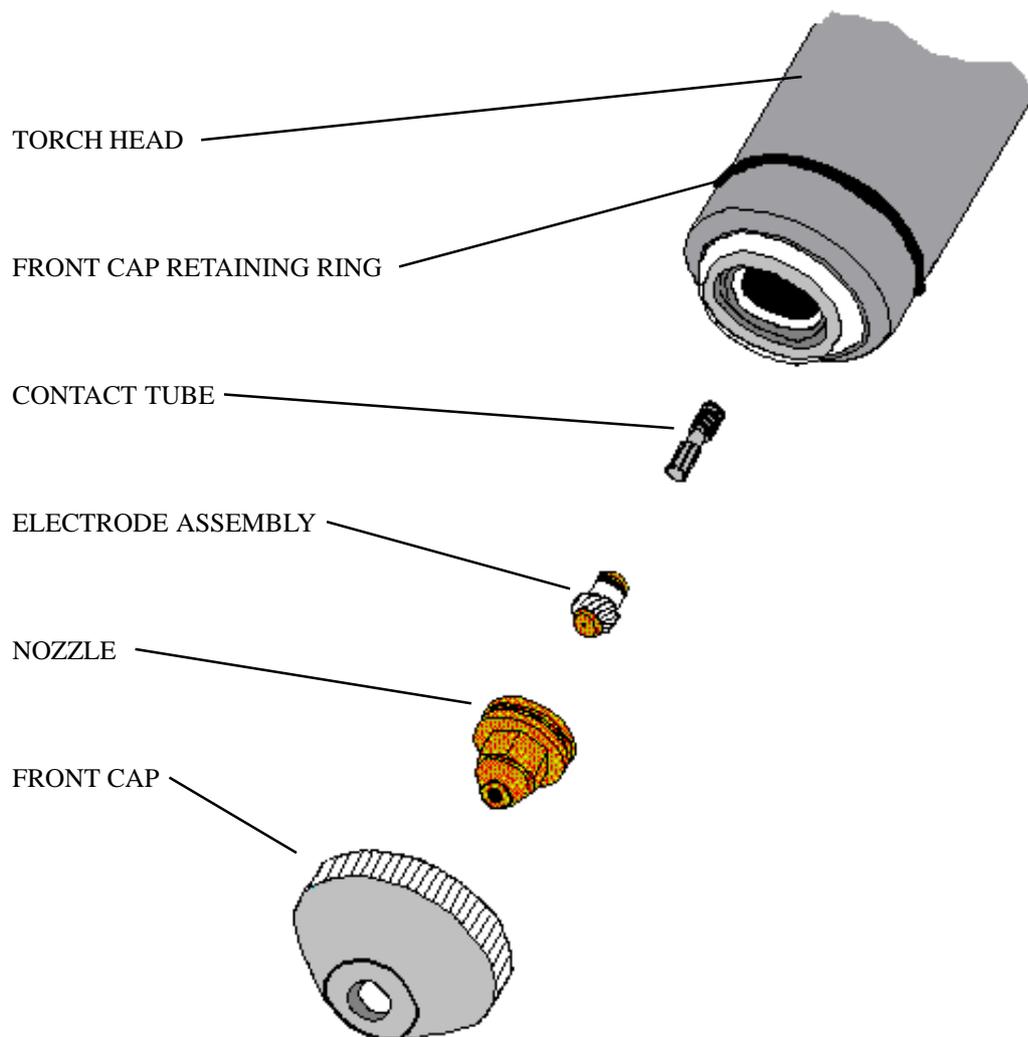

To renew the consumables, the following procedure should be adopted, remembering that care and cleanliness are of the utmost importance.

1. Switch the machine off at the mains supply or Main Isolator.
2. Remove the Front Cap. The cap is a push fit over the O ring seated in a groove in the outer diameter of the Torch Body.



3. Unscrew the Nozzle with the special tool supplied. (See illustration left).

4. Check the condition of the Electrode Assembly. If it is to be removed, grip the Electrode Assembly with the special Electrode Pliers provided, and pull firmly out from the torch body. (See illustration right).



5. Press a new Electrode Assembly carefully but firmly over the contact tube until it is fully home and central. Use the handle of the Nozzle Tool which has been prepared for this purpose. **THIS IS VERY IMPORTANT !** If the Electrode is not pressed fully home onto the Contact Tube, the Swirl Bush may be partly crushed by the Nozzle, and will interfere with the airflow.
6. Carefully screw the Nozzle into the Torch Head using the special tool until fully home. **DO NOT OVER TIGHTEN.**
7. Apply a liberal quantity of Silicone Grease around the front of the torch.
8. Refit the push fit Front Cap. Apply additional grease over the outside of the front cap. The grease will provide a first line of defence against material blown back from the cutting process.

Remember that cleanliness and care must be taken when fitting consumables. Do not allow dirt to obstruct the threaded parts of the torch. Take care when engaging threaded parts not to damage the thread.

#### CONTACT TUBE REPLACEMENT.

Should the Contact Tube need changing, it is removed by inserting the 1/8" allen key supplied into the centre and unscrewing. Replacement is the reverse of removal but **it is important not to over tighten** as this may cause subsequent electrode fitment to be off centre, producing bevel cuts.

## 6. TECHNICAL DATA

### 6.1 Power Unit

#### 6.1.1 Electrical Input

Input is via 3 core and earth flexible: 4 x 6mm<sup>2</sup> 3 metre length standard.

Machines are available for the following 3 phase supplies:

**Note.** When the power unit is connected to a generator it may be necessary to disconnect the power factor correction capacitors (if fitted) in the power unit if they disturb the generator's automatic voltage control. This does however increase supply current. See below or rating plate.

Input Voltage		Without correction	With correction
380v	50 Hz	60 amps	
415v	50 Hz	55 amps	
440/480v	60 Hz	50amps	

Other voltages and frequencies available to order

#### 6.1.2 Electrical Output

Open circuit voltage	300v dc
Typical arc voltage	150v dc
Main arc power	18kW
Pilot arc current	15 - 20 amps nominal
Duty cycle	60%

#### 6.1.3 Miscellaneous

Compressor type	Oil free twin cylinder.
Water pump type	Regenerative type.
Water capacity	3 litre (aprox. dependant on hose length) distilled or deionised water

#### 6.1.4 Dimensions

Height	660mm	(26.0 in)
Width	540mm	(21.3 in)
Depth	1200mm	(47.3 in)
Weight	140kg	(310 lb)

## 6.2 Torch and Hose Set

### 6.2.1 Hand Torch

Torch body diameter	40mm
Torch head weight	1.0 kg
Effective weight (inc. hose set)	1.5 kg
Hose set lengths available	7.5m, 15m, 20m, 30m, longer with Junction Box.
Hose set water capacity	0.6 litres per 10m length

### 6.2.2 Machine Torch

Torch body diameter	40mm
Torch body length	200mm
Torch head weight:	1.0 kg
Hose set lengths available	7.5m, 15m, 20m, 30m, longer with Junction Box.
Hose set water capacity	0.6 litres per 10m length

## **7. SERVICE INFORMATION**

### **7.1 The Power Unit**

Output power is supplied from a fan cooled transformer and rectifier with varistor diode protection. The transformer is rated at 60% duty cycle and is protected by a thermostat.

The power is carried to the torch electrode by a cable within the hose set.

Pilot arc connection to the nozzle is made via a current limiting resistor in the rear of the machine and a coaxial cable in the hose set. The HF arc ignition is fully automatic in operation, being powered from the torch power lines.

The compressor, cooling fan, and water pump are the only “phase sensitive” components and it is essential to ensure that their direction of rotation is correct according to the installation instructions (see section 3).

These components are protected by thermal / magnetic overload switches. If an overload should operate, it can be reset by first removing the machine cover then pressing the manual reset button on the overload unit situated behind the instrument panel after establishing the reason for the trip (e.g. missing supply phase).

The transformer, water radiator and the pilot arc resistor, are cooled by an electric fan. A temperature sensing interlock inside the transformer windings protects the system against thermal overload should the cooling fail or be obstructed hence it is essential to ensure adequate air circulation around the machine at all times.

The air compressor is of the oil free, maintenance free, twin piston type fitted with two cleanable/replaceable inlet filters contained in black screw-in housings with a snap open lids.

The high pressure water pump supplies cooling water to the torch through quick release, self sealing couplings so that the torch can be disconnected without the loss of water from the system. There is an interlocked flow sensor on the return line which shuts down the arc if the water flow should be restricted.

The header tank must be kept full of distilled water at all times. If site conditions dictate that antifreeze should be used, then up to 33% METHANOL may be added.


**NOTE.** Ethylene glycol or automotive type antifreeze fluids **MUST NOT BE USED**, as they will cause rapid corrosion of the torch.

Whenever any of the interlocks come into operation the appropriate warning light on the front panel will indicate to assist in the diagnosis of the problem.

#### **7.1.1. Main Circuits and Systems.**

The Circuit Diagram is shown in drawing 1/D/10773

# 7.1.1. Circuit Diagram

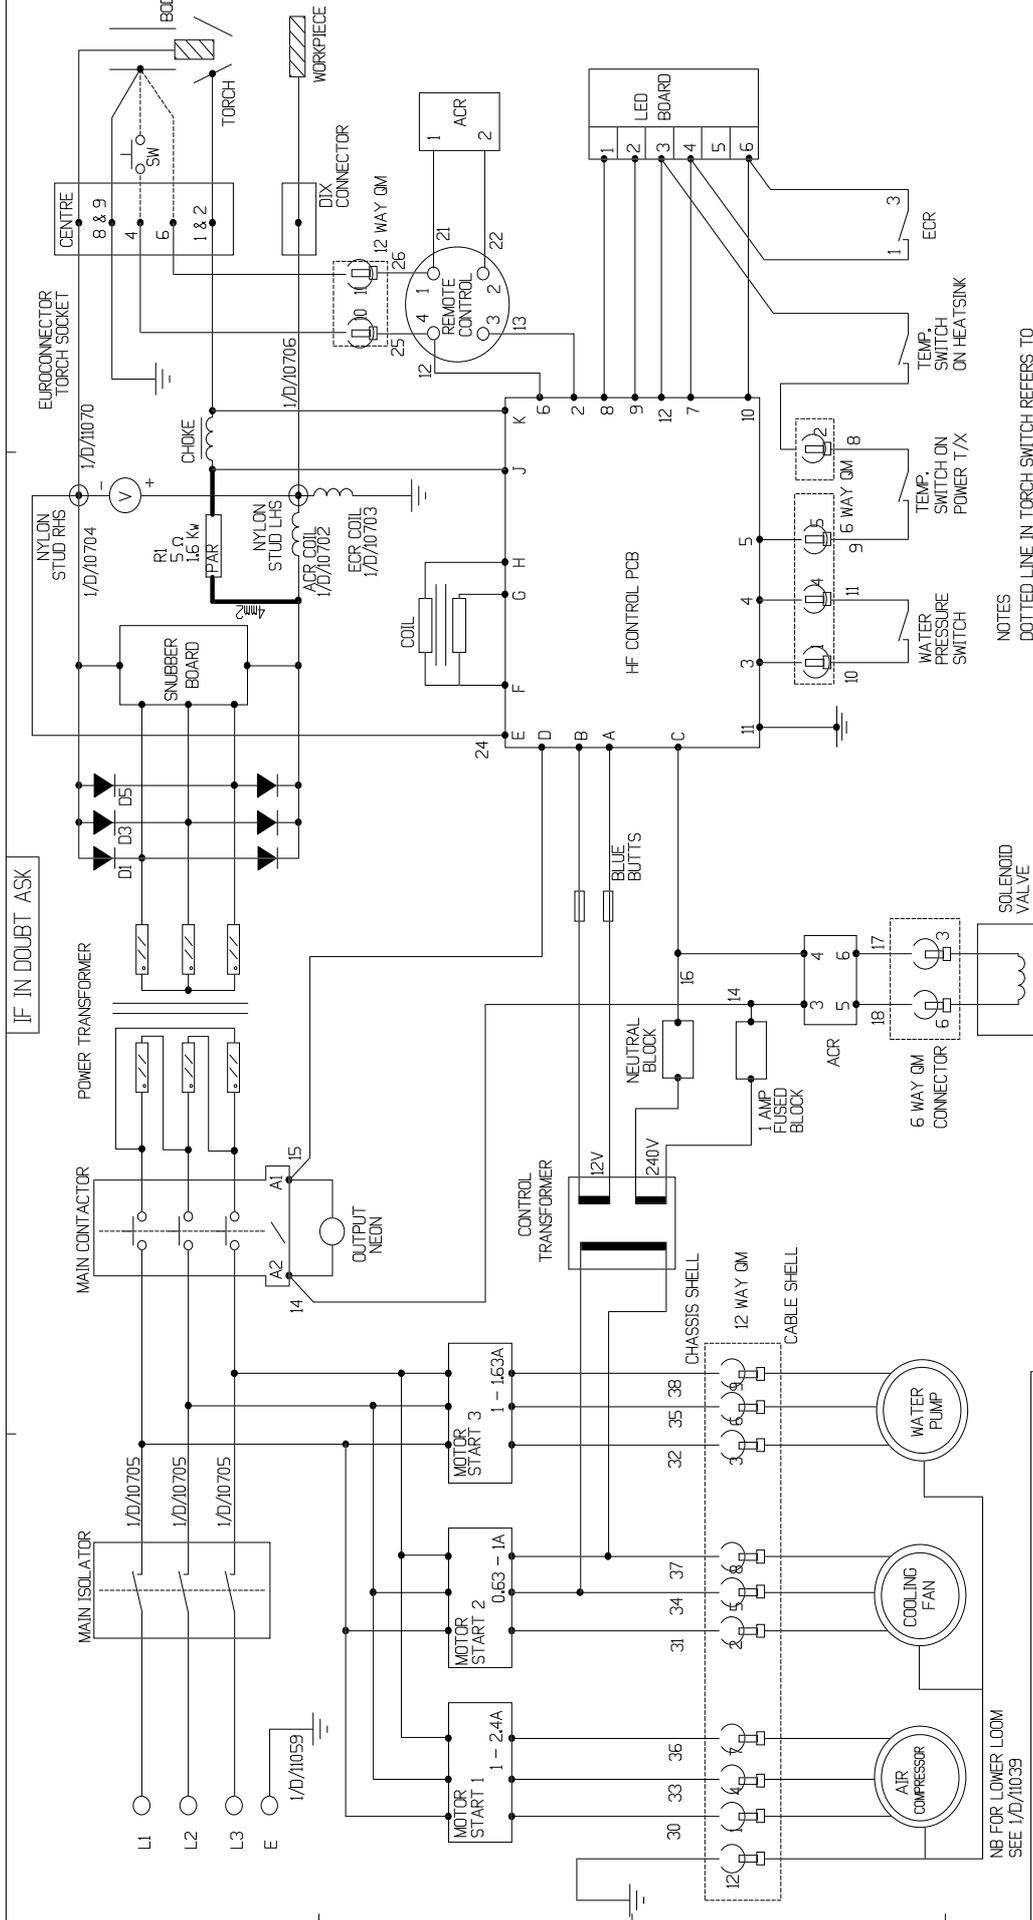

ISSUE	DATE	CHECKED BY	REQUESTED CHANGE
5	30/1/98		NEW LOOM FROM DEC. 1997 I.D NOS ADDED.

NOTES  
 DOTTED LINE IN TORCH SWITCH REFERS TO  
 PIN 6 CONNECTED IN MACHINE TORCH, PIN 4 CONNECTED IN HAND TORCH

ALL DIMENSIONS IN MILLIMETRES

**GOODWIN AIR PLASMA Ltd.**  
 KERNAN DRIVE, LOUGHBOROUGH, LEICESTERSHIRE LE11 5JF Tel:01509 237369  
 Fax:01509 234942

**TITLE P18**  
 MATERIAL  
 SPEC  
 DRAWN BY P.W  
 DATE 12/8/93 R.M.  
 DRG No. 1/D/10773

CIRCUIT DIAGRAM

## **7.1.2. Diagnostic Indicators.**

### **OUTPUT ON NEON**

Indicates that power is applied to the torch.

### **POWER INDICATOR**

Indicates that 12V power is available to the system control circuit.

### **READY INDICATOR**

Indicates that all system interlocks are operational and that the machine is ready to operate.

### **TEMPERATURE INDICATOR**

Indicates that the main transformer temperature is too high. Cutting operations will immediately stop. Leave the machine running to allow the fan to cool the transformer. The safety systems will automatically reset when the temperature drops.

### **WATER INDICATOR**

Indicates no water in the system, a water leak, torch blockage, low pump supply pressure or incorrect motor/fan rotation. See section 7.2 for torch blockage. When water flow is restored, the system will reset automatically.

### **CURRENT TRIP INDICATOR**

Indicates the main arc cutting current is flowing in a secondary path. System will stop until the torch switch is released. (See section 3.2 for cutting earth requirements).

## 7.1.2. Machine Layout

## 7.2 The Torch and Hose Set Repair

The torch is a precise assembly of electrically conductive parts and P.T.F.E. insulators housed in a stainless steel body. It is supplied with compressed air, water and electrical power at high voltage which must not be allowed to escape from their designed confines.

Rebuilding torches requires special training and instruction and is not within the scope of this manual. Users who wish to repair damaged torches themselves should consult their supplier or Goodwin Air Plasma for detailed advice.

A torches should be removed from the power unit complete with hose set. Once removed, the torch head may be serviced or repaired.

If a spare torch and hose set is available, the machine may be put back in service whilst repairs are carried out.

### TORCH BLOCKAGE.

The water flow in the torch can occasionally become blocked, usually with scale because deionised / distilled water has not been used or has become contaminated. Also, copper deposits can accure as a result of expiry of an electrode. See section 8 of this manual.

### TORCH / HOSE JUNCTION BOX ON MACHINE INSTALLATIONS .

A Junction box is offered as an optional extra to provide a facility for the fast removal of the torch head. Useful for service or change of use with minimum loss of production time, the junction box links all the control services carried by the hose set to the torch. Another advantage of the junction box is that it will allow the majority of the hose set, which may be lengthy and difficult to remove from an automatic machine, to remain in situ.

### 7.3 Maintenance

<b>Daily</b>	Check condition of the consumables. Top up water reservoir with distilled / demineralised water.
<b>Monthly</b> (depending on usage)	Check for water and air leaks, clean the air compressor intake filters. Remove excessive dust from inside the machine taking care not to damage any mechanical or electrical component and avoid exposure to this dust which may represent a health hazard. Use personal protection as necessary.
<b>Annually</b> more frequently in poor conditions or with high usage	Replace the compressor air intake filter. Check tightness of all electrical and mechanical connections. Check the correct operation of all controls and indicators.

Goodwin Air Plasma Cutting Systems are designed so that only a minimum amount of maintenance is required. By following a regular and careful maintenance procedure, the equipment will give a long productive life.

## 8.2 Hand Torch

1. Remove the Front Cap, Nozzle and Electrode.
2. Remove Back Cap and Front Ring (using Special tool).
3. Remove Rear Cover by carefully tapping the side of the Torch on a piece of wood, this will cause it to fall out. This will reveal the HF Strap and HF Screws.
4. Using a small flat bladed screw driver unscrew the two screws. This will allow the Nozzle Holder to be removed.
5. Carefully ease out the Centre Insulator taking care not to lose the four Water Seals. This will reveal the Cathode Block.
6. Clean out the two water galleries using a small drill bit by hand, taking care not to push the blockage any further into the Cathode Block.
7. Clean holes in the Centre Insulator in the same way.
8. The Nozzle Holder is cleaned in the same way, however this may have a blockage within the circular water gallery, (check this by blowing into one of the holes, if the air flows freely it is ok to re-use) if it is blocked it will need replacing before rebuilding the torch.
9. Check Water Seals for damage. Replace if necessary and refit into Centre Insulator.
10. Check length of HF screws as they may have stretched. If they are over 35mm they should be replaced.
11. Refit Centre Insulator to Cathode Block taking care not to dislodge Water Seals.
12. Refit Nozzle Holder to Centre Insulator taking care to align screws with threaded holes and tighten.
13. Refit Front Insulator over Nozzle Holder, if this is damaged replace it.
14. Refit Front Ring and Back Cap taking care not to cross thread.
15. Fit Nozzle and Electrode to torch.
16. Remove water return pipe connection from the Machine (Long water fitting) and start Machine, allow water to run out until the air lock is released (the water jet will stop then restart). Run machine for a further five seconds, this will allow any debris left in the torch head to be ejected. Switch off Machine and reconnect hose set.

**NOTE** If the jet of water coming out of the removed return water connection is not between 300 to 500mm long then the torch may still be blocked and should be stripped down completely or sent to Goodwin Air Plasma for repair.

# 8.4 Machine Torch exploded View

VIEW OF REAR OF CATHODE BLOCK  
TO SHOW LOCATION OF WATER AND AIR PIPES

ITEM	PART No.	DESCRIPTION	DRAWING
01	PC2001	FRONT CAP	1/0/10291
02	PC2002	FRONT CAP RETAINING RING	1/0/10053 04
03	***	NOZZLE (SEE INSET )	1/0/10293
04	PC001	ELECTRODE ASSEMBLY	1/0/10312
05	PC002	CONTACT TUBE	1/0/10330
06	PA20HD06	MACHINE TORCH BODY	1/0/10214
07	PA20HD020	FRONT INSULATOR	1/0/10197
08	PA20HD023	NOZZLE HOLDER	1/0/10192
09	PC2005	WATER SEAL O RING	1/0/10053 03
10	PA20HD02	CATHODE BLOCK	1/0/10189
11	PA20HD03	REAR INSULATOR	1/0/10211
12	PA20HD04	H.F. STRAP	1/0/10234
13	PA20HD11	H.F.SCREW INSULATOR	1/0/10314 04
14	PA20HD12	H.F. SCREW	M3 x 35 BRASS
15	PA20HD05	REAR INSULATOR CAP	1/0/10301
16	PA20HD07	STUB TUBE	1/0/10292
17	PA20HD14	WATER FEED PIPE ASSY	1/0/10401 02
18		SLEEVE NUT	
19	PA20HD16	WATER FEED PIPE INSULATOR	1/0/10314 01
20	PA20HD13	WATER RETURN PIPE ASSY	1/0/10401 03
21	PA20HD17	WATER RETURN PIPE INSULATOR	1/0/10314 05
22	PA20HD15	AIR POWER PIPE ASSY	1/0/10401 01
23	PA20HD18	AIR POWER PIPE INSULATOR	1/0/10314 02
24	PA20HD08	MOUNTING TUBE	1/0/10215
25		GRUB SCREW	M3 x 6mm

IF IN DOUBT ASK

4 24/10/96 ISSUE DATE

DMAC. REQUESTED BY

CHECKED BY

REFERENCE TO FIG NOZZLE ADDED

CHANGE

ALL DIMENSIONS IN MILLIMETRES

NOT TO SCALE

MATERIAL

SPEC

DRAWN BY PETER WILCOCK

DATE 26/11/85

TITLE

EXPLODED VIEW OF WATER COOLED MACHINE TORCH

DRG No. 1/0/10158

THIS DRAWING IS THE PROPERTY OF GOODWIN AIR PLASMA LTD. IT IS STRICTLY CONFIDENTIAL AND MUST NOT BE COPIED, LOANED, OR DISCLOSED TO OTHER PARTIES WITHOUT THEIR PERMISSION. COPYRIGHT IS STRICTLY RESERVED.

**GOODWIN AIR PLASMA Ltd.**

KERNAN DRIVE, LOUGHBOROUGH, LEICESTERSHIRE LE11 5JF Tel:01509 237369 Fax:01509 234942

## 9. Fault Finding

Below is a list of the most common reasons for **non operation** of a Goodwin Air Plasma Cutting System.

Symptom	Probable cause	Remedy
No Pilot arc at torch head when torch button is depressed	a) Machine Ready Light not on b) Output Indicator not on.	Check for red indicator being on (If so refer to Manual) Check torch switch and 220v fuse.
As above with output indicator on.	c) Non starting electrode. d) Volt meter not reading 300v	(Refer to manual) Telephone Goodwin Air Plasma
As above with voltmeter reading 300v.	e) No HF on P C Board f) Broken HF cable on hose set	Telephone Goodwin Air Plasma Telephone Goodwin Air Plasma
Current trip indicator coming on	a) Electrode incorrectly fitted b) Low air flow through torch c) An other path to mains earth	Refit correctly Increase flow, check for air leaks Ensure workpiece is completely isolated from mains earth
Misfiring pilot arc	a) Too much air flowing through the torch b) Blown diode	Decrease flow Telephone Goodwin Air Plasma
Tracking :- Spark appears at front of torch and no pilot arc.	a) Slag build up on Front Cap b) Front Insulator damaged	Clean slag from around Nozzle Replace Front Insulator
Front Caps and Nozzles burning up rapidly.	a) Incorrect operation of torch b) Not using Silicone Grease	See operating instruction pages Apply Silicone Grease
Excessive bevel, poor cut quality	a) Damaged Consumables. b) Electrode eroded off centre c) Misaligned Consumables  d) Low air pressure  e) Cut speed too fast f) Stand off too high	Change Consumables Change Consumables Change Contact Tube and consumables Clean air filters, check for air leaks See operating instruction pages See operating instruction pages

## 10. Index

- A**
- Accessories
    - Automatic Height Control 15
- C**
- Circuit diagram 23
  - CNC 15
  - Compressor 20, 21
  - Consumable
    - Damage to 12
    - Life of 16, 17
    - Replacement 18, 19
  - Contact Tube 18, 19
  - Controls
    - Air regulator 11
    - Hi Lo Output switch 10
    - Main Isolator 5, 10
  - Cutting
    - Bevel 16
    - Blow back 17
    - High Frequency (HF) 6
    - Main arc 6
    - Piercing 14, 15
    - Pilot arc 6
    - Power up procedure 11
    - Process explained 6
    - Robot 4
    - Speed 13
    - Stand off 12
    - Thick materials 14
    - Ventilation 4
    - Water table 4
- D**
- Duty cycle 21
- E**
- Earth Current Relay (ECR) 7
  - Electrode 18
  - Emergency stop 5
- F**
- Fault Finding
    - Air leak 8, 11
    - Bevel 16
    - Current trip 7, 11
    - Dross 16
    - Troubleshooting 16
  - Front Cap. *See* Consumable: Replacement
  - Front Cap Retaining Ring. *See* Consumable: Replacement
- G**
- Goodwin Air Plasma 2
  - Guide Ring 12
- H**
- Handling
    - Lifting 5
    - Packaging 5
  - Health and Safety 2
- I**
- Identification
    - Warning signs 5
  - Indicator
    - Air pressure 11, 24
    - Bargraph 10
    - Current trip 11, 24
    - Output On 10, 11, 24
    - Power 10, 24
    - Ready 10, 24
    - Temperature 10, 24
    - Voltage 24
    - Voltage indicator 10
  - Installation
    - Earth lead connection 8
    - Earth requirements 7
    - Electrical supply 7, 11, 20
    - Phase determination 7
    - Remote control 9
    - Torch connection 8
- M**
- Maintenance 26
- N**
- Nozzle. *See* Consumable: Replacement
  - Nozzle Holder. *See* Consumable: Replacement
- O**
- Overload 21
- P**
- Plasma
    - Flare 12
    - Process 4
  - Profiling. *See* CNC
- R**
- Remote control 11
  - Retaining ring. *See* Consumable: Replacement
  - Robot. *See* CNC
- S**
- Safety
    - General 4
    - Mains connection 4
    - Noise 4
    - Personal protection 4
  - Service
    - Hose 25
    - Removing canopy 5
    - Torch 25
  - Silicone Grease 19
- T**
- Technical Data 20
  - Torch
    - Hand torch operation 9
    - Machine torch operation 9
  - Training 4